

Hyperglass Dark Matter

- Preparation

- To apply products like these your vehicle must be in a temperature and humidity controlled environment during application and for at least 10 hours after.
- Wash and decontaminate the glass using a Clay bar to remove hard bonded contaminants.
- Use glass polish to further clean and prepare the surface.
- Wipedown the glass using a dish wash solution.
- Soak the glass with 1:1 IPA and magic eraser.
- Use new microfiber glass cloth for final wipedown with 1:1 IPA.
- Glass should be smear and residue free after final wipedown.

- Application

- Apply 15-20 drops to your applicator and apply thick.
- Add product to your applicator if it gets too "dry" when applying.
- Apply the first layer of Hyperglass in a circular motion then cross-hatch.
- If doing windscreen it's best to break down the application area into 2-4 sections.
- Do not wipe off.
- Apply the second layer of Hyperglass on top of the first layer after 15 minutes in a circular motion then cross-hatch.
- Do not wipe off.
- Apply the third layer of Hyperglass on top of the first two layers after 15 minutes in a circular motion then cross hatch.
- 1 layer will do on side windows.
- Do not expose the glass to the elements for at least 10 hours.
- Wipe off all residue after 4 hours or overnight.
- Do not wash for the first 14 days.

- Additional

- Please wait 15 minutes before layering or stacking.
- IR lamp can be used to speed up the process.
- If wiper blades are not new, change to a new set of blades.
- Wiper blades should be coated with Hyperglass.

- Hyperglass Maintenance

- *Clay bar the glass every 6 months.*